

B.S.A. CYCLES LTD.

Service Sheet No. 74.

July, 1937.

MOTOR CYCLE.

LEAKAGE FROM OIL TANK FILLER CAP on the 1937 "B" and "M" Group Models.

As pressure release pipe is provided at the oil tank and should this be restricted the pressure will build up in the tank and a leakage past the filler cap result. Therefore, should a leakage develop from the filler cap insert a piece of flexible wire into the pipe at the end located just in front of the rear mudguard, and pass the wire up the pipe until the end protrudes through the small orifice that will be seen when the filler cap and filter gauze have been removed. In this way any obstruction that may have been in evidence will be cleared away.