

B.S.A. CYCLES LTD.

Service Sheet No. 73.

July, 1937.

MOTOR CYCLE.

OIL LEAKAGE FROM MAGNETO DRIVE—1937 "B" and "M" Group Models.

An oil leakage at the magneto drive usually indicates that the magneto has been allowed to become loose. If such a leakage develops slacken off the magneto retaining strap, draw the instrument away from the timing case a small amount and re-secure the strap. This will allow the taper seating oil retaining washer to bed down on to the corresponding seating in the timing case, thereby ensuring an oil tight seal.