



APRIL 1972

No. 10/72

Service sheet

B25/B50 ENGINES

CONTACT BREAKER

B.S.A. Motor Cycles Limited,
Service Department, Armoury Road,
Birmingham, B11 2PX.

Lack of attention to the contact breaker and automatic advance-and-retard timing mechanism, can lead to the corrosion of these items, due to the accumulation of condensation.

In this event, the timing mechanism may be the cause of erratic running and in extreme cases may become completely ineffective.

To prevent this accumulation, drill a 1/16" dia. hole in the base of the contact breaker housing, in accordance with the details given in the illustration, thus providing a means of drainage for the condensation.

