



BSA INCORPORATED • 639 PASSAIC AVENUE • NUTLEY, NEW JERSEY 07110 • TELEPHONE (201) 667-5600  
EASTERN STATES DISTRIBUTOR FOR BSA MOTORCYCLES / A SUBSIDIARY OF THE BIRMINGHAM SMALL ARMS COMPANY, LTD. OF ENGLAND

---

## despatch to all dealers:

SERVICE BULLETIN # 35-69

September 4, 1969

FROM: WALTER BROWN, SERVICE MANAGER

SUBJECT: OIL LEAKAGE AT THE ROCKER BOX TO CYLINDER HEAD  
GASKET. B25 MODEL

---

Oil seepage at the rocker box cylinder head joint face, which may be evident on some machines, can be cured by plugging the two 1/8" diameter holes on the joint face of the rocker box.

Two plugs are required No. 41-551, these should be driven into the holes flush with, or slightly below the joint face, using a light smear of jointing compound.

Always use a new gasket when replacing the rocker box.