

# HINTS AND TIPS ON — SERVICE —

For **BSA** Dealers

from **BSA** Incorporated, 639 Passaic Avenue, Nutley, N. J.

Bulletin #262

Dec. 7, 1967

SUBJECT: OIL TANK

OIL LEVEL ON C25 STARFIRE AND  
B44 SHOOTING STAR MODELS.

WARNING: DO NOT FILL THE OIL TANK TOO HIGH!

It has been discovered that when there is too much oil in the oil tank a pressure builds up and the oil is forced out of the oil tank breather and also restricts the return of the oil from the engine causing the crankcase to load up with oil.

The oil cap dip stick "FULL" mark "H" on 1967 and early 1968 Starfire and Shooting Star models is too high - 3-5/8" up from the bottom end of the stick.

The Factory has recommended that the "H" mark on the oil tank dip stick be lowered 7/16" so that it measures 3-3/16" up from the bottom end. This operation must be performed on the B25 and B44 models you sold during 1967 and on early deliveries of 1968 models.

INSTRUCTIONS: Scribe an "X" through the original "H" mark and scribe a new "H" mark 3-3/16" up from the bottom of the stick.

You must caution your mechanic and owners of B25 Starfire and B44 Shooting Star models not to fill the oil tanks higher than the new oil level.

BSA Incorporated

*Walter Brown*  
Walter Brown,  
Service Manager

WB/gd