

SERVICE BULLETIN #23-69

May 6, 1969

FROM: Walter Brown, Service Manager

SUBJECT: Oil Leak at Gearbox Sprocket, Model A75 Rocket 3

An oil seal has been added at the gearbox mainshaft between the end of the high speed gear and the clutch hub.

This oil seal, Part No. 57-1956 will prevent gearbox oil from seeping out along the gearbox mainshaft and the high gear bush as shown in the illustrations below:

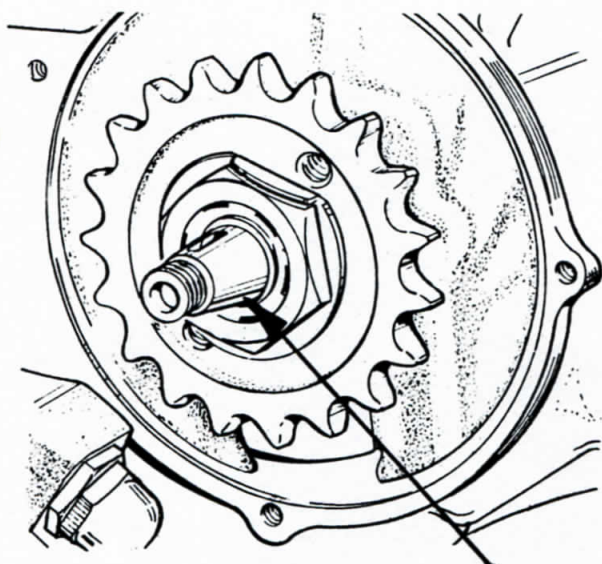


Illustration showing area of possible oil leakage at gearbox mainshaft high gear bush.

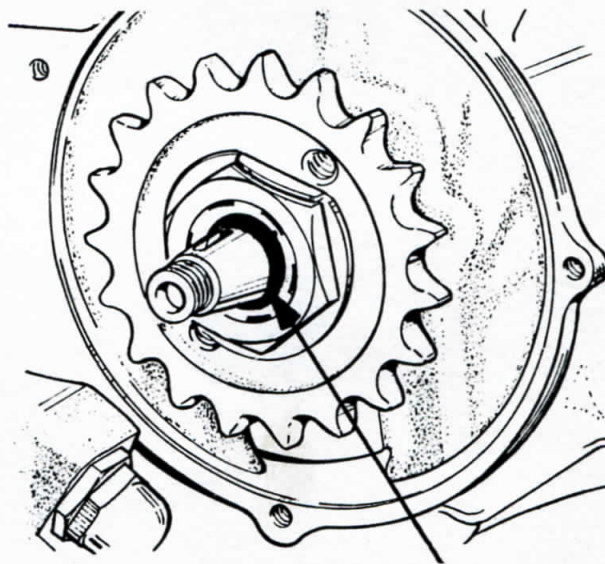


Illustration showing oil seal Part No. 57-1956 fitted on gearbox mainshaft.

The seals may be ordered from our Parts Department in the normal manner and when the motorcycle is still within the Warranty period, a Warranty Credit Claim can be submitted for the seal and the labor. The labor allowance Code Numbers for installing the seal are No. 1.03 and No. 1.33. The total labor \$21.25.

Be sure to provide complete information when submitting a claim.