



BSA INCORPORATED • 639 PASSAIC AVENUE • NUTLEY, NEW JERSEY 07110 • TELEPHONE (201) 667-5600  
EASTERN STATES DISTRIBUTOR FOR BSA MOTORCYCLES / A SUBSIDIARY OF THE BIRMINGHAM SMALL ARMS COMPANY, LTD. OF ENGLAND

---

## despatch to all dealers:

SERVICE BULLETIN #21-69

May 6, 1969

FROM: Walter Brown, Service Manager

SUBJECT: Erratic Low Speed Running - Model- A75 Rocket 3

Erratic low speed running may be experienced in a few isolated cases, although all the normal settings are satisfactory.

This trouble can usually be overcome by blocking off the balance holes in the carburetor adaptor.

To do this proceed as follows:

1. Turn off fuel at the taps and remove fuel tank.
2. Remove carburetors, complete with air filter and adaptor, by releasing hose clips next to cylinder head.
3. Disconnect throttle cable at arm assembly and remove spindle after releasing circlip from right-hand end.
4. Remove six carburetor stud nuts, swing arm assembly up and take adaptor away from carburetors.
5. Remove hose clips and hose from adaptor.
6. Heat adaptor in hot water or degreasing tank, then press out the three steel sleeves towards the carburetor joint face. Turn each sleeve 180° before pressing back into the adaptor while still warm.
7. Check that all balance holes are effectively blocked off before replacing parts in the reverse order.