

AUGUST 1970

No. 276



SERVICE SHEET

A65FS INCORRECTLY ASSEMBLED REAR BRAKE

A65 Firebird Scramblers with engine and frame numbers between 10019 and 10322 have the rear brake lever, part number 42-6045, incorrectly assembled.

These machines have the rear brake operating lever fitted at 1 o'clock in relation to the cam spindle and on full depression of the rear suspension, the brake rod fouls the silencer bracket, 70-9995 and consequently operates the brake.

To rectify, remove the brake lever from the cam spindle refitting it at the 5 o'clock position using return spring part number 68-6134.