

HINTS AND TIPS ON — **SERVICE** —

For **BSA** *and* **ARIEL** *Dealers*

Service Bulletin #138

May 17, 1963

A50 - A65 MODEL GEARBOX BREATHER VENT TO OVERCOME OIL LEAKAGE

A 3/64 inch hole has been added to the gearbox oil filler cap to relieve any pressure that may build up inside the gearbox shell.

When there are signs of oil leaking out of the gearbox at the drive sprocket into the rear chain enclosure, or at the kick-starter and foot change lever spindles, inspect the gearbox oil filler cap.

If there is no hole in it -- drill a 3/64" hole in the cap along side of the screwdriver slot.

WB/jc

Walter Brown
Service Manager