

HINTS AND TIPS ON

SERVICE

For **BSA** Dealers

from **BSA** Incorporated, 639 Passaic Avenue, Nutley, N. J.

Service Bulletin #213

April 20, 1966

1964 - 1965 - A65 Series (650 CC Twins)

 
SUBJECT: CLUTCH NOISE IN PRIMARY DRIVE

There have been occasions when 1965 Lightning owners complained about a noise on the left side of the engine and gear box unit at the primary drive when the machine is idling or ridden at slow speed.

This noise is the clutch pack "chucking" in the clutch chain wheel and it can be eliminated by removing all the clutch plates and assembling a Raybesto Spacing Disc on the clutch driver against the clutch chain wheel. After this disc is assembled in position then the clutch plates may be replaced in the normal manner along with the other parts.

<u>Part No.</u>	<u>Description</u>	<u>List Price</u>
B-662	Raybestos Clutch Spacing Disc	\$1.92

These discs are available now and may be ordered from our parts department in the usual manner.


WALTER BROWN
Service Manager

All prices subject to change without notice.