

HINTS AND TIPS ON —SERVICE—

For **BSA** and **ARIEL** Dealers

Service Bulletin #165

June 12, 1964

SUBJECT: OVERHEAD ROCKER OIL FEED LINES ON ALL A50 AND A65 MODELS

WARNING:


We have received reports that a number of rocker box oil feed lines have broken off at the oil tank fitting.

If this oil feed line to the rocker box is too close to the frame bracket, the movement of the rubber mounted tank is apt to cause it to break.

You must inspect all the machines you have sold and the ones you have on your Showroom Floor and if the rubber connector touches the frame bracket you must force it up close against the oil tank as far away as possible from the frame bracket.

You must tell your A50 and A65 model owners about this situation after you have relocated the oil line and ask them to watch for oil leaks and check the oil level in their tanks periodically and by so doing it will cut down the chances of having engine failures due to loss of oil and lack of lubrication.

The Factory is aware of this situation and corrections are being made so that it will be taken care of on future production.

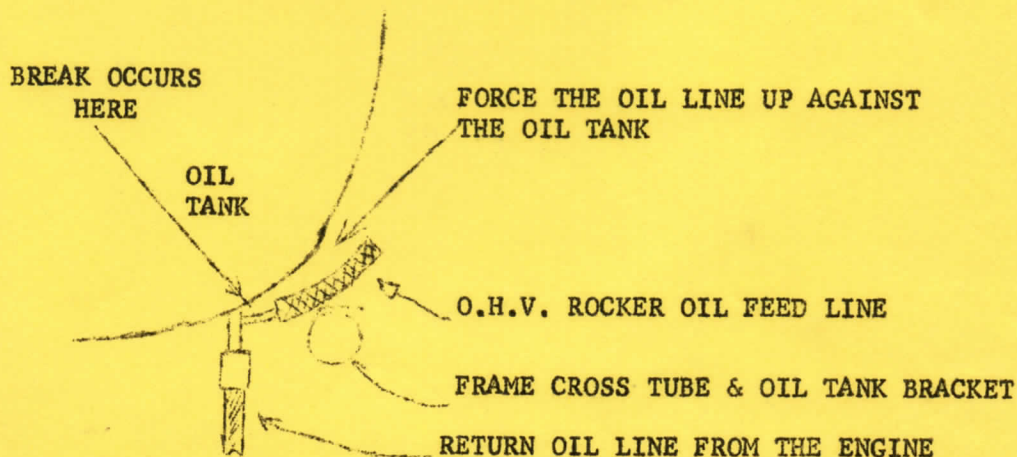

Walter Brown
Walter Brown
Service Manager

BSA Incorporated, 639 Passaic Avenue, Nutley N. J.