

# HINTS AND TIPS ON — **SERVICE** —

For **BSA** Dealers

from **BSA** Incorporated, 639 Passaic Avenue, Nutley, N. J.

Service Bulletin #208

February 14, 1966


SUBJECT: NEW LARGER - THICKER EXHAUST VALVES - A65 SERIES

## CAUTION

The 1966 EXHAUST Valve (new valve, 68-0663) has a much thicker head approximately .050) than any previous exhaust valve for the BSA A65 series motorcycles (old valve, 68-0157).

If you are using the new one as a replacement valve for any BSA A65 series built before 1966 - - it will be necessary to recess (cut deeper) the exhaust valve pocket in the top of the pistons ... or... you may install the new 1966 style piston (68-0784) which has the deeper pockets as standard.

Don't take a chance- - a bent valve will cause extra service work and a very angry customer.

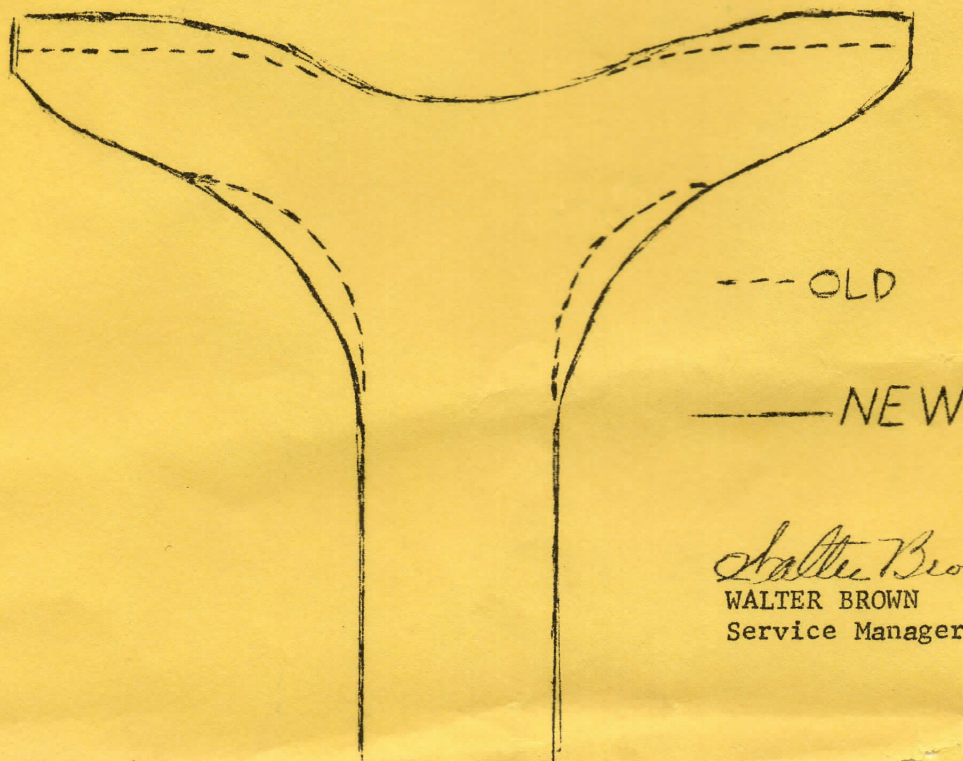

*Walter Brown*  
WALTER BROWN  
Service Manager