



JULY 1971

No. 24/71

Service sheet


B.S.A. Motor Cycles Limited,
Service Department, Armoury Road,
Birmingham, B11 2PX.

EXHAUST SYSTEM

B50 MX


A limited number of the first B50 MX models to be despatched had a condition whereby on full compression of the rear suspension, the megaphone silencer fouled the rear wheel spokes.

To rectify, deform the outlet end of the megaphone cone by compressing in a clamp or vice to make the outlet oval and measure $1\frac{1}{4}$ " across. Secondly, fit a $\frac{1}{4}$ " distance piece between the megaphone bracket and its fixing point on the frame.

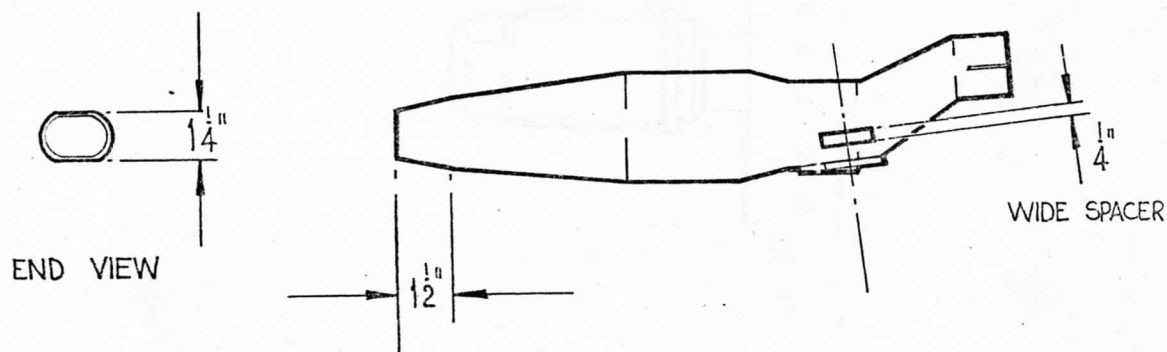

Top view of megaphone silencer

LIMITED ISSUE

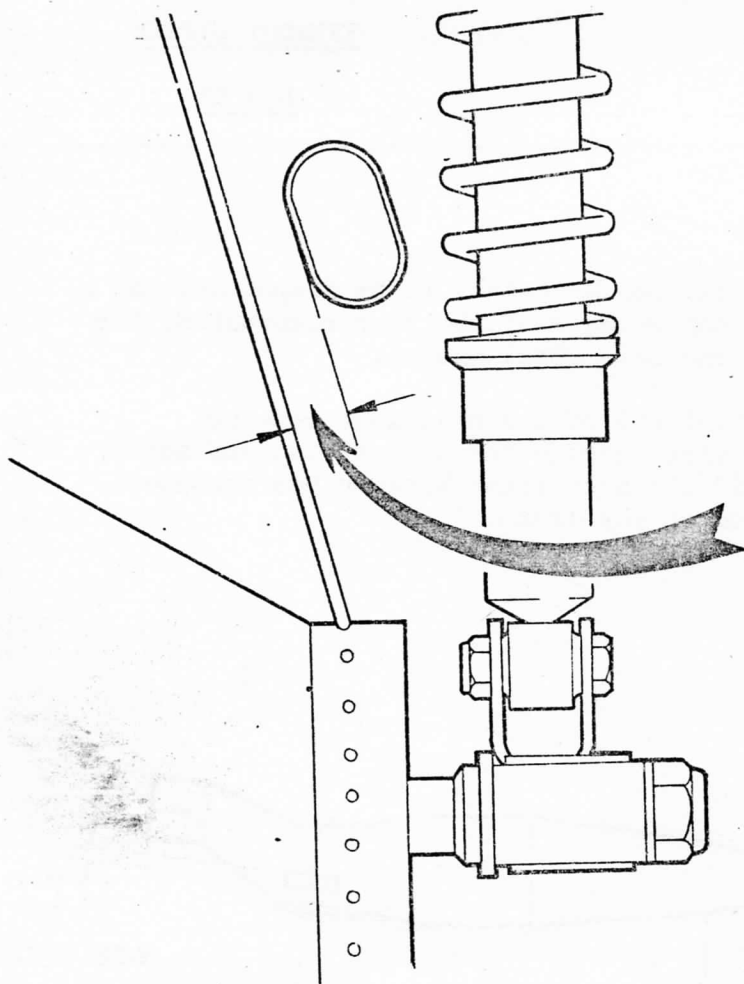

Outlet of megaphone silencer
to be parallel with spokes.